CONTINENTAL INDUSTRIES

The Ultimate Connection

Plug Tee Installation Instructions

Weld Inlet x Compression Outlet for PE Pipe

- 1. Verify that the compression outlet on the service tee is the correct size for the polyethylene (PE) pipe. Verify the SDR (or wall thickness) of the pipe matches the SDR (or wall thickness) stamped on the end of the stiffener.
- 2. Remove the pipe cap, valve plug, outlet seal ring and compression nut from the plug tee and place in the plastic bag in which the plug tee was shipped.
- 3. Clean the main of all coatings, rust, dirt, etc., in the area where the service tee is to be welded onto the main.

IMPORTANT

 
For use on: Polyethylene (PE) gas pipe meeting the requirements of ASTM D 2513

Pressure Rating: Designed to meet or exceed pressure rating of PE pipe per 49 CFR Part 192 and ASTM D 2513

Operating Temperature: -20 to 140° F

Material: Carbon Steel

- 4. Weld plug tee to main per your company's welding procedures.
- 5. When the outlet is cool to the touch, make the service connection. See other side for outlet assembly instructions.
- 6. To assure proper assembly and to comply with 49 CFR 192 Subpart J—Test requirements, the joint shall be leak tested.
- 7. For drilling operation, refer to drilling machine manufacturer's instructions.
- 8. Apply thread sealant and install pipe cap leak tight.









Compression Outlet for PE Pipe Installation Instructions

 - 1. Install the compression nut and seal ring onto the outlet. Do not tighten the compression nut.
- 2. Cut polyethylene pipe end square, deburr inside and outside, clean thoroughly to assure there is no dirt, grease, oil, etc. on assembly area of pipe.
- 3. Mark stab length on pipe (see examples for correct pipe or tubing size and corresponding stab length).



- 4. Insert the polyethylene pipe through the compression nut until it bottoms in the outlet. (See detail "A")
- 5. Tighten compression nut until it bottoms on shoulder (metal to metal). (See detail "B") The stab length line should be no more than 3/16" from face of the compression nut.
- 6. If the stab length line is more than 3/16" from the face of the compression nut, diassemble the joint and repeat steps 1 through 5.

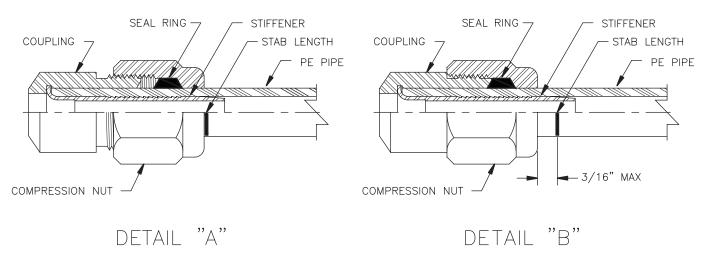

NOTE: It is advisable to limit shear at main connections. In this regard, your company's policies should be followed. For further information, reference; ASTM D 2774 Standard Practice for Underground Installation of Thermoplastic Pressure Piping; Code of Federal Regulations, Title 49, Transportation Part 192; AGA Plastic Pipe Manual and/or The Guidance Manual for Operators of Small Gas Systems by the U.S. Department of Transportation.