


# **B: Cable Preparation**

Strip cable to expose metal clad sheath. Strip length to suit equipment. Slide shroud (if applicable), backnut @ and middlenut @ onto cable. For preparation of Drain Wires see separate Al 2028.

If an inner sheath is not present and using Express Resin, use electrical tape wrapped around the base of the cores to create a suitable sealing surface.



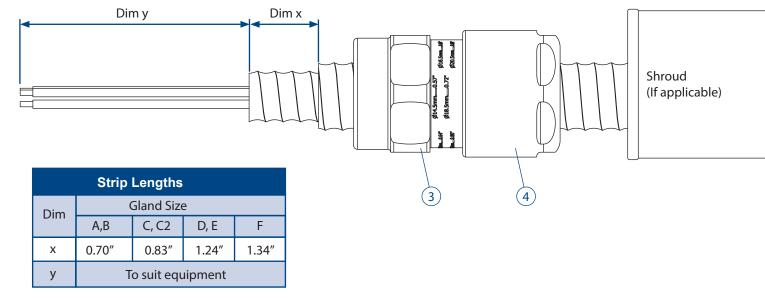




# C: Installing Cable Gland


## **STEP 1: Fit Diablo**

Slide diablo ② onto cable. Ensure that diablo ② is positioned on the exposed metal clad sheath, with the rear end of the diablo at the point where the cable is stripped as shown below.

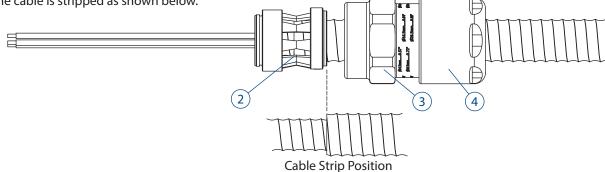

# STEP 2: Prepare to Clamp Armour/Braid


Slide Entry ① over cable.

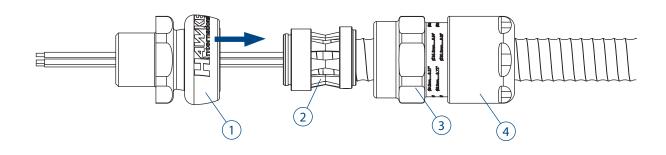

# STEP 3: Engage Diablo


Ensuring that the diablo stays in place, tighten the middlenut  $\Im$  onto the entry  $\Im$  with a wrench until the diablo grips the metal clad sheath.

Tighten the middlenut ③ a further half turn with a wrench/spanner.

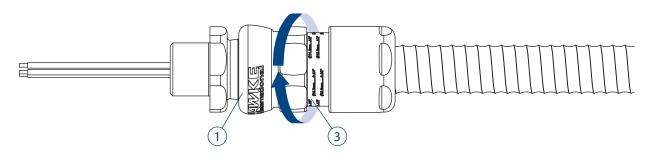

# STEP 4: Inspect Armour/Braid

Unscrew the middle nut ③ and visually inspect that the diablo ② has adequately clamped the metal clad sheath. If clamping is not satisfactory, repeat step 3.

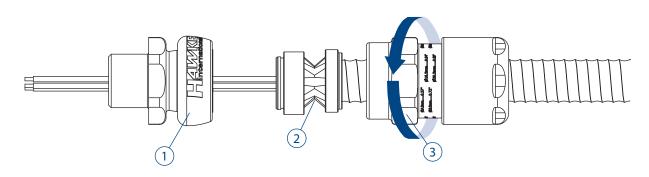


Images for illustration purposes only.
AI 2024 - Issue D / Page 2 of 4 Product supplied may differ from that shown.

#### STEP 5: Fit to Enclosure

Now diablo is fitted, use a wrench to fit entry 1 into enclosure. If required, use the appropriate IP washer 5.

Slide cable through entry ① until diablo ② is seated in the entry.

Hand tighten the middlenut ③ to entry and add 1/2 turn with a wrench.

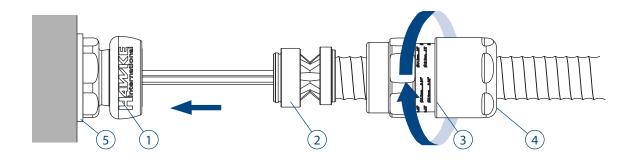


## **STEP 6: Install Backnut**

Tighten the backnut @ until a seal is formed around the cable.


Use a wrench/spanner to grip the middlenut ③.

While preventing the middlenut ③ turning, use a second wrench to apply one further full turn to the backnut ④.

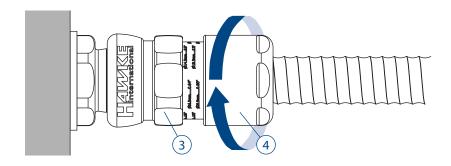

## STEP 7: Inspect Backnut

Use the middlenut @ guide as an indication that the backnut @ is in the correct position to suit cable diameter. A diameter scale below is provided to assist in this process.

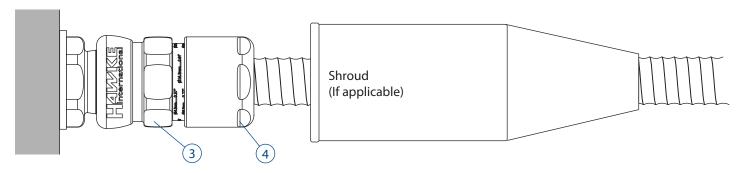

If enclosure end of middlenut is exposed, pull down deluge boot to cover the exposed end.

Images for illustration purposes only.
Al 2024- Issue D / Page 3 of 4 Product supplied may differ from that shown.

# Technical Information **701**



**TECHNICAL DATA** 

Cable Gland Type: 70

**Equipment Type:** American Series Cable Glands **Ingress Protection:** IP66, IP67, IP68\*, IP69, Type 4X

\*30m for 7 days to EN60529 with thread sealant 10m for 24hrs no thread sealant; A-C size only

Operating Temp: -50°C to +80°C

#### **CERTIFICATION DETAILS**

UL: Class I, Zone 1, AEx e IIC, Ex eb IIC Gb; Zone 21, AEx tb IIIC, Ex tb IIIC Db UL listed for use with cable types MC, MC-HL, ITC-HL, TECK90 and RA90. Listing No. E84940

Suitable for Wet Locations

#### **INSTALLATION NOTES**

- 1. All cable glands must be installed by a suitably trained and competent individual.
- 2. Entry threads are in accordance with Metric BS3643 or ANSI/ASME B1.20.1
- 3. Installer must check material compatability with enclosure and environment.
- 4. To maintain IP66/IP67/IP69, Hawke certified sealing washer or other approved sealing method must be used.
- 5. Sealing face surface must be smooth and free from damage
- 6. All entries must be installed perpendicular to the mounting surface.

#### **ACCESSORIES**

Hawke offer the following accessories to enable correct ingress protection and grounding of cable gland.

Shroud:For additional corrosion protectionLocknut:To secure gland into positionSealing Washer:For additional ingress protectionEarth Tag:For external bonding point

**Serrated Washer:** To prevent vibration loosening locknuts

#### SPECIFIC CONDITIONS OF USE

1. When the gland is used for increased safety, the entry thread shall be suitably sealed to maintain the ingress protection rating of the associated enclosure.

#### **TORQUE VALUES**

All torque values below were generated on metallic mandrels. For cable, it is recommended that the assembly instructions are followed.

Torque Figures N/m										
Gland Size	Os	0	Α	В	С	C2	D	Е	F	
Backnut Torque	12	12	20	30	35	45	56	60	75	

CABLE GLAND SELECTION TABLE											
Size Ref.	Entry Thread Size		Ca	ble Acc	eptance De	Max	Hexagon Dimensions				
			Armour Sheath		Outer 9				Sheath		
	Metric	NPT	Min. Dia	Max. Dia	Min.	Max.	Length	Across Flats	Across Corners		
Α	M20	1/2" - 3/4"	0.41"	0.64"	0.49"	0.81"	2.94"	1.18"	1.28"		
В	M25	3⁄4" - 1"	0.55"	0.93"	0.67"	1.02"	3.24"	1.42"	1.56"		
C	M32	1" - 1¼"	0.85"	1.23"	0.87"	1.30"	3.52"	1.81″	1.99″		
C2	M40	11⁄4" - 11⁄2"	1.17"	1.59"	1.10"	1.61″	3.81"	2.17"	2.39"		
D	M50	1½" - 2"	1.37"	1.96"	1.42"	2.07"	4.77"	2.56"	2.79"		
Е	M63	2" - 2½"	1.81"	2.55"	1.81"	2.57"	4.74"	3.15"	3.46"		
F	M75	21/2" - 3"	2.37"	2.98"	2.24"	3.07"	4.94	3.74"	4.09"		