

11th of December 2023

### Safety Notice (Coal Mining Hazardous Area ONLY)

### <u>Austdac Pullkey – Aluminium Crimp</u>

#### Issue

As previously notified Austdac is voluntarily notifying customers that, due to an error by our production partner, certain Austdac branded Pullkey products manufactured between January 2020 and March 2023 may contain an aluminium crimp that is not in accordance with the published product specifications. While Austdac is not aware of any product failures or injuries, we note that per the product specifications, Pullkeys should be fitted with a plated copper or stainless steel crimp.

Photo 1 below shows the location of the relevant crimp. In the event that an aluminium crimp was used on the Pullkey, the crimp will be in the form of a figure 8, as is shown in Photo 2. The plated copper or stainless steel crimp will appear as a hexagonally shaped crimp, as shown in Photo 3.



**PHOTO 1: PULLKEY** 

## austdac®

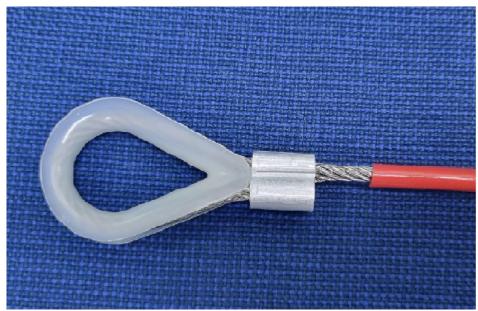


PHOTO 2: ALUMINIUM CRIMP SHOWN. NOTE THE FIGURE OF 8 SHAPE.

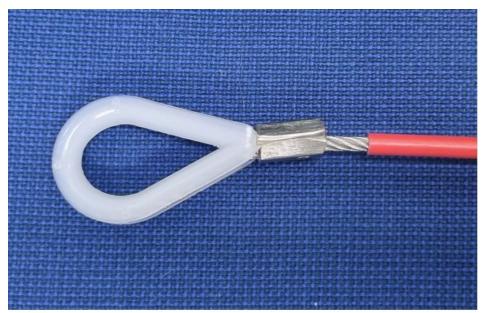


PHOTO 3: STAINLESS STEEL CRIMP SHOWN. NOTE THE HEXAGON SHAPE.

A snap on protective cover has been designed and is shown in photo 4, 5, 6 and 7.

# austdac®

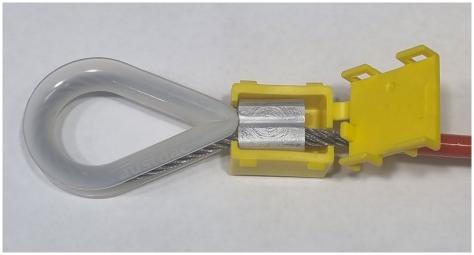


PHOTO 4: PROTECTIVE COVER SHOWN OPEN.



PHOTO 5: PROTECTIVE COVER TOP.

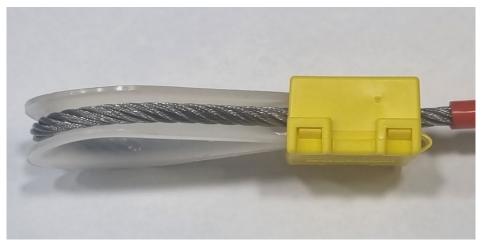


PHOTO 6: PROTECTIVE COVER SIDE.

## austdac®

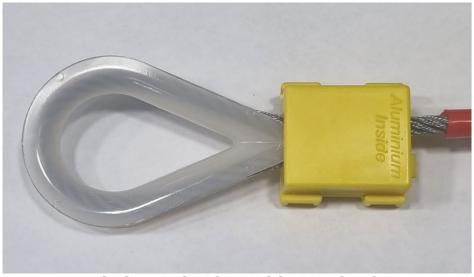


PHOTO 7: PROTECTIVE COVER BOTTOM.

A cable tie may be used for additional security as shown in photos 8 and 9.



PHOTO 8: PROTECTIVE COVER BOTTOM WITH CABLE TIE.

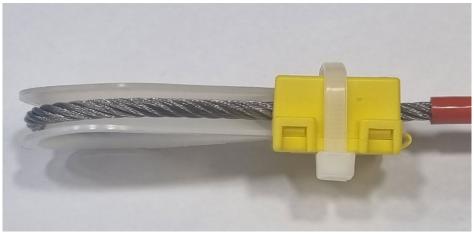


PHOTO 9: PROTECTIVE COVER SIDE WITH CABLE TIE.



Supply of these covers will occur in early 2024.

#### Contact

For further information or to request free covers (Austdac Part Number: COVR042) please contact either Austdac Customer Service or Peter Chan;

Austdac Customer Service Telephone: 1800 568 984

Email: <u>customerservice@austdac.com.au</u>

or

Peter Chan

Mobile: 0448 939 809

Email: plchan@austdac.com.au

Regards

Peter Chan Head of Quality