


DRAWING NO.  
**10051635**

BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	CABLE SIZE	WELD METAL	HANDLE CLAMPS
B-1635	10048917	#6	65	B-106
B-1636	10048918	#4	65	B-106
B-1637	10048919	#3	65	B-106
B-1638	10048920	#2	65	B-106
B-1639	10048921	#1	90	B-106
B-1640	10048922	1/0	150	B-106
B-1641	10048923	2/0	150	B-106
B-1642	10048924	3/0	200	B-106
B-1643	10048925	4/0	200	B-106
B-1644	10048926	250 kcmil	200	B-106
B-1645	10048927	300 kcmil	250	B-106
B-1646	10048928	350 kcmil	2-150	B-107
B-1648	10048929	500 kcmil	2-200	B-107
B-1649	10048930	750 kcmil	500	B-107
B-1650	10048931	1000 kcmil	3-200	B-107

REV.	DATE	DESCRIPTION	ECO	BY	C'K'D.
B	11/26/12	CORRECT CONDUCTOR SIZE FOR B1650 MOLD.	29544	DD	MB

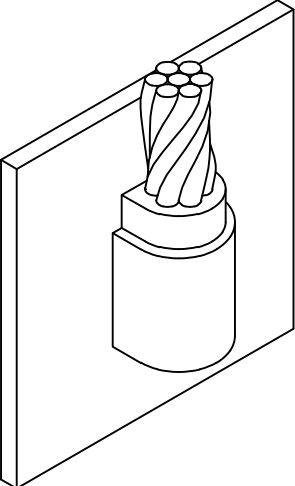

**NOTES:**

- BCS-7 TYPE MOLDS ARE USED TO JOIN AN OVERHEAD VERTICAL COPPER CONDUCTOR DROP TAP TO A VERTICAL STEEL SURFACE.
- SIZE RANGE IS #6 THROUGH 1000 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX '-S' TO MOLD NUMBER FOR SOLID CONDUCTORS.
- FOR HEAVY DUTY MOLDS, ADD SUFFIX 'H' TO MOLD NUMBER
- REQUIRED TOOLS:  
HANDLE CLAMPS (SEE CHART FOR CORRECT HANDLES). FOR HANDLES SEE DWG. 10051615.  
B38-0309-00: FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH  
B38-0101-00: RASP

<p>TO ORDER BURNDY® PRODUCTS CALL</p> <p>UNITED STATES: 1-800-346-4175 (LONDONDERRY, NH)</p> <p>CANADA: 1-800-361-6975 (QUEBEC) 1-800-387-6487 (ALL OTHER PROVINCES)</p> <p>FOR PRODUCT INFO: <a href="http://www.burndy.com">http://www.burndy.com</a></p>	BURNDYweld™ OVERHEAD VERTICAL TAP CABLE TO VERTICAL STEEL SURFACE		
	ITEM NO: N/A		
	CAT NO: BCS-7 SERIES		
	SCALE: N/A		
	DRAWN BY: P LAPONIUS 12/8/04		
	CHECKER: D SHIBILIA 1/3/05		
	DSN APPVL: D SHIBILIA 1/13/05		
	MFG APPVL: -- --	QC APPVL: J BRODEUR 1/14/05	DRAWING NO
	MKT APPVL: R ROBICHEAU 1/18/05	10051635	
	PROJECT #	SIZE	REV
DOCUMENT TYPE: Sales	D	B	
REL LEVEL: AutoCAD	SHEET 1 OF 1		