

Catalog Number Type	Wire Size	Color Code and Die Index Number	Mechanical & Ratchet Dies Required (# Crimps)		Mechanical & Ratchet Dedicated Die Tools # Crimps				
	Conductor (CU Only)		MD6 and MD7 Series <small>*Due to handle force not recommended</small>	OUR840 <small>*Due to handle force not recommended</small>	MY28 and MY29 Series	MRC840	MRE1022B Y8MRB1 Y10D Y1022	Y122CMR	Y1MRTC
YA-10	#14 - #10 AWG B,C,I,K,M DLO	—	—	—	—	—	1 CRIMP	1 CRIMP	—
YA-8C-L-FX	#8 AWG B,C,G,H,I,K,M DLO #6 Sol / #8 Sol	RED 49	X8CRT (1) W8CRT (1) W8CVT (1)	X8CRT (1) W8CRT (1) W8CVT (1)	1 CRIMP	1 CRIMP	—	1 CRIMP	1 CRIMP
YA-6C-L-FX	#6 AWG Sol B,C,G,H,I,K,M DLO	BLUE 7	X5CRT (1) W5CRT (1) W5CVT (1)	X5CRT (1)	1 CRIMP	1 CRIMP	—	1 CRIMP	1 CRIMP
YA-4C-L-FX	#4 AWG B,C,G,H,I,K,M DLO	GRAY 8	X4CRT (1) W4CRT (1) W4CVT (1)	X4CRT (1)	1 CRIMP	1 CRIMP	—	2 CRIMPS	2 CRIMPS
YA-3C-L-FX	#3 AWG B,C,G,H,I,K,M DLO	WHITE 9	W3CRT (1)	—	1 CRIMP	1 CRIMP	—	2 CRIMPS	2 CRIMPS
YA-2C-L-FX	#2 AWG B,C,G,H,I,K,M DLO	BROWN 10	X2CRT (1) W2CRT (1) W2CVT (1)	X2CRT (1)	1 CRIMP	1 CRIMP	—	2 CRIMPS	2 CRIMPS
YA-1C-L-FX	#1 AWG B,C,G,H,I,K,M DLO	GREEN 11	X1CRT1 (1) W1CRT1 (1) W1CVT (1)	X1CRT1 (1)	1 CRIMP	1 CRIMP	—	—	—
YA-25-L-FX	1/0 AWG B,C,G,H,I,K,M DLO	PINK 12	X25RT (2) W25RT (2) W25VT (2)	X25RT (2) W25RT (2)* W25VT (2)*	1 CRIMP	2 CRIMPS	—	—	—
YA-26-L-FX	2/0 AWG B,C,G,H,I,K,M DLO	BLACK 13	X26RT (2) W26RT (2) W26VT (2)	X26RT (2) W26RT (2)* W26VT (2)*	1 CRIMP	2 CRIMPS	—	—	—
YA-27-L-FX	3/0 AWG B,C,G,H,I,K,M DLO	ORANGE 14	X27RT (3) W27RT (2) W27VT (2)	X27RT (3) W27RT (2)* W27VT (2)*	1 CRIMP	2 CRIMPS	—	—	—
YA-28-L-FX	4/0 AWG B,C,G,H,I,K,M DLO	PURPLE 15	X28RT (3) W28RT (2) W28VT (2)	X28RT (3) W28RT (2)* W28VT (2)*	1 CRIMP	2 CRIMPS	—	—	—
YA-29-L-FX	250 kcmil B,C 4/0 AWG G,H,I,K,M DLO	YELLOW 16	X29RT (4) W29RT (2) W29VT (2)	X29RT (4) W29RT (2)* W29VT (2)*	1 CRIMP	—	—	—	—
YA-30-L-FX	250 kcmil G, H	YELLOW 16	X29RT (4) W29RT (2)* W29VT (2)	X29RT (4) W29RT (2)* W29VT (2)*	—	—	—	—	—
YA-31-L-FX	250 kcmil I,K,M 262 DLO	WHITE 17	W30RT (2)* W30VT (2)	—	—	—	—	—	—
YA-32-L-FX	300 kcmil G,H,I,K,M 313 DLO	RED 18	W31RT (2)* W31VT (2)	—	—	—	—	—	—
YA-34-L-FX	350 kcmil G,H,I,K,M 373 DLO	BLUE 19	W32RT (2)* W32VT (2)	—	—	—	—	—	—

Compression Connections

Copper Flex Standard Barrel Terminal Tooling Table Hydraulic Requiring Dies and Dieless

Catalog Number Type	Wire Size	Color Code and Die Index Number	Hydraulic Tools - Dies Required (# Crimps)					Hydraulic Tools - Dieless	
	Conductor (CU Only)		MD6, 600, 500 Series	750, 35 Series	45 Series Use PT6515 with U Dies	46 Series Use PUADP1 with U Dies	60 Series	81K 4PC Series	644 444 Series
YA-10	#14 - #10 AWG B,C,I,K,M DLO	—	—	—	—	—	—	—	—
YA-8C-L-FX	#8 AWG B,C,G,H,I,K,M DLO #6 Sol / #8 Sol	RED 49	X8CRT (1) W8CRT (1) W8CVT (1)	U8CRT (1)	U8CRT (1)	U8CRT (1)	—	1 CRIMP	—
YA-6C-L-FX	#6 AWG Sol B,C,G,H,I,K,M DLO	BLUE 7	X5CRT (1) W5CRT (1) W5CVT (1)	U5CRT (1)	U5CRT (1)	U5CRT (1)	—	1 CRIMP	—
YA-4C-L-FX	#4 AWG B,C,G,H,I,K,M DLO	GRAY 8	X4CRT (1) W4CRT (1) W4CVT (1)	U4CRT (1)	U4CRT (1)	U4CRT (1)	—	1 CRIMP	—
YA-3C-L-FX	#3 AWG B,C,G,H,I,K,M DLO	WHITE 9	W3CRT (1)	U3CRT (1)	U3CRT (1)	U3CRT (1)	—	1 CRIMP	—
YA-2C-L-FX	#2 AWG B,C,G,H,I,K,M DLO	BROWN 10	X2CRT (1) W2CRT (1) W2CVT (1)	U2CRT (1)	U2CRT (1)	U2CRT (1)	—	1 CRIMP	1 CRIMP
YA-1C-L-FX	#1 AWG B,C,G,H,I,K,M DLO	GREEN 11	X1CRT1 (1) W1CRT1 (1) W1CVT (1)	U1CRT1 (1)	U1CRT1 (1)	U1CRT1 (1)	—	1 CRIMP	1 CRIMP
YA-25-L-FX	1/0 AWG B,C,G,H,I,K,M DLO	PINK 12	X25RT (2) W25RT (2) W25VT (2)	U25RT (1)	U25RT (1)	U25RT (1)	—	1 CRIMP	1 CRIMP
YA-26-L-FX	2/0 AWG B,C,G,H,I,K,M DLO	BLACK 13	X26RT (2) W26RT (2) W26VT (2)	U26RT (1)	U26RT (1)	U26RT (1)	—	1 CRIMP	1 CRIMP
YA-27-L-FX	3/0 AWG B,C,G,H,I,K,M DLO	ORANGE 14	X27RT (3) W27RT (2) W27VT (2)	U27RT (1)	U27RT (1)	U27RT (1)	—	1 CRIMP	1 CRIMP
YA-28-L-FX	4/0 AWG B,C,G,H,I,K,M DLO	PURPLE 15	X28RT (3) W28RT (2) W28VT (2)	U28RT (1)	U28RT (1)	U28RT (1)	L28RT (1)	1 CRIMP	1 CRIMP
YA-29-L-FX	250 kcmil B,C 4/0 AWG G,H,I,K,M DLO	YELLOW 16	X29RT (4) W29RT (2) W29VT (2)	U29RT (1)	U29RT (1)	U29RT (1)	L29RT (1)	1 CRIMP	1 CRIMP
YA-30-L-FX	250 kcmil G, H	YELLOW 16	X29RT (4) W29RT (2) W29VT (2)	U29RT (1)	U29RT (1)	U29RT (1)	L30RT (1)	1 CRIMP	1 CRIMP
YA-31-L-FX	250 kcmil I,K,M 262 DLO	WHITE 17	W30RT (2) W30VT (2)	U30RT (2)	U30RT (2)	U30RT (2)	L31RT (1)	1 CRIMP	1 CRIMP
YA-32-L-FX	300 kcmil G,H,I,K,M 313 DLO	RED 18	W31RT (2) W31VT (2)	U31RT (2)	U31RT (2)	U31RT (2)	L32RT (1)	1 CRIMP	1 CRIMP

Catalog Number Type	Wire Size	Color Code and Die Index Number	Hydraulic Tools - Dies Required (# Crimps)					Hydraulic Tools - Dieless	
	Conductor (CU Only)		MD6, 600, 500 Series	750, 35 Series	45 Series Use PT6515 with U Dies	46 Series Use PUADP1 with U Dies	60 Series	81K 4PC Series	644 444 Series
YA-34-L-FX	350 kcmil G,H,I,K,M 373 DLO	BLUE 19	W32RT (2) W32VT (2)	U32RT (2)	U32RT (2)	U32RT (2)	L34RT (1)	1 CRIMP	1 CRIMP
YA-36-L-FX	500 kcmil G,H 444 DLO	BROWN 20	—	U34RT (2)	U34RT (2)	U34RT (2)	L36RT (1)	1 CRIMP	1 CRIMP
YA-38-L-FX	500 kcmil H,I,K 550 kcmil G,H,I 535 DLO	PINK L99	—	U38XRT (2)	U38XRT (2)	U38XRT (2)	L38RT (1)	1 CRIMP	1 CRIMP
YA-39-L-FX	600 kcmil G,H,I,K DLO	PINK 400	—	U38RT (2)	U38RT (2)	U38RT (2)	L39RT (1)	2 OVERLAPPING CRIMPS	1 CRIMP
YA-40-L-FX	650 kcmil G 646 DLO	BLACK 24	—	U39RT (2)	U39RT (2)	U39RT (2)	L40RT (1)	2 OVERLAPPING CRIMPS	1 CRIMP
YA-44-L-FX	750 kcmil G,H,I 777 DLO	YELLOW L115	—	U44XRT (2)	U44XRT (2)	U44XRT (2) P44XRT (2)	L44RT (2)	2 OVERLAPPING CRIMPS	1 CRIMP
YA-45-L-FX	929 kcmil DLO	WHITE 27	—	P44RT (2)	S45RT (2)	P45RT (2)	L45RT (1)	—	—

Installation Instructions

Installation instructions help the installer understand proper wire preparation, proper insertion requirements, crimp zone location, individual crimp location, crimp order and crimp direction, to ensure safe and reliable wire connections. UL Listing and CSA Certification are only valid when using the BURNDY® Engineered System and following BURNDY Installation Instructions.

Copper Flex Standard Barrel Terminal Installation Steps:

1. Select the appropriate connector based on:
 - Wire Material
 - Wire Construction
 - Wire Size
2. Strip the insulation to the appropriate wire strip length, based on the table's Wire Strip Length recommendation for the selected connector. Due to tolerances in the connector, wire strip length, and insulation stripping tools, this range may be 0" - 1/4". The exposed wire, also known as a "shiner", has no performance impact on the connection and there is no wire exposure requirement by BURNDY.
3. As a best practice, wire brush the bare conductor to remove any oxides. DO NOT wire brush tin-plated connectors.
4. Insert the conductor into the barrel for the full length. If the connector has an inspection window, the conductor end can easily be seen to verify full wire insertion.
5. Apply the proper number of crimps specified by the appropriate illustration.
6. *Some catalog numbers require overlapping crimps when using the 81K or 4PC Series of installation tools. Please refer to the overlapping crimp image that is applicable based on the number of crimps required. Overlap each consecutive crimp so that the completed installation of all overlapping crimps covers the entire crimp zone.
7. Once all crimps have been completed, the connection can be easily inspected for proper installation.

NOTE: Illustrations show black bands however this is just a representation of the crimp zones. See individual connector for actual crimp band color.


Example: YAV28LNT38FX

Go to the YA-28-L-FX Catalog Number Designation for 4/0 AWG G,H,I,K,M or DLO.
 Confirm the Tool (750 Series for this example).
 Confirm the Die Set Needed (U28RT for this example)
 Confirm the Number of Crimps Necessary (1 for this example)
 For proper crimp placement refer to the image on this page corresponding to the number of crimps.


CATALOG NUMBER DESIGNATIONS		
YA-8C-L-FX	YA-6C-L-FX	YA-4C-L-FX
YA-3C-L-FX	YA-2C-L-FX	YA-1C-L-FX



CATALOG NUMBER DESIGNATIONS			
YA-25-L-FX	YA-26-L-FX	YA-27-L-FX	YA-28-L-FX
YA-29-L-FX	YA-30-L-FX	YA-31-L-FX	YA-32-L-FX
YA-34-L-FX	YA-36-L-FX	YA-38-L-FX	YA-39-L-FX*
YA-40-L-FX*	YA-44-L-FX*	YA-45-L-FX	

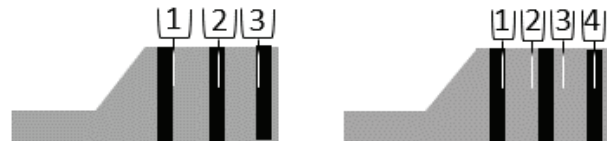

2 Overlapping

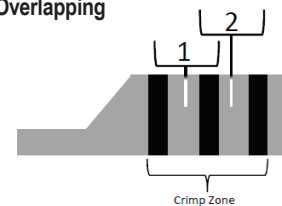

YAV28LNT38FX

750 Series Tool

U28RT Die Set

Completed Crimp Installation