


BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	CABLE		WELD METAL	HANDLE CLAMPS
		RUN	TAP		
-----	-----	#6	#6	--	--
B-423	10047653	#4	#4	45	B-106
B-424	10047654	#3	#3	45	B-106
B-425	10047655	#2	#2	65	B-106
B-426	10047656	#2	#4	65	B-106
B-427	10047657	#1	#1	65	B-106
B-428	10047658	#1	#2	65	B-106
B-429	10047659	#1	#4	65	B-106
B-430	10047660	1/0	1/0	90	B-106
B-431	10047661	1/0	#1	90	B-106
B-432	10047662	1/0	#2	90	B-106
B-433	10047663	1/0	#4	90	B-106
B-434	10047667	2/0	2/0	115	B-106
B-435	10047668	2/0	1/0	115	B-106
B-436	10047669	2/0	#1	115	B-106
B-437	10047670	2/0	#2	115	B-106
B-438	10047671	3/0	3/0	150	B-106
B-439	10047672	3/0	2/0	150	B-106
B-440	10047673	3/0	1/0	115	B-106
B-441	10047674	3/0	#1	115	B-106
B-442	10047675	3/0	#2	115	B-106
B-443	10047676	4/0	4/0	200	B-106
B-444	10047677	4/0	3/0	200	B-106
B-445	10047678	4/0	2/0	150	B-106
B-446	10047679	4/0	1/0	150	B-106
B-437	10047680	4/0	#1	115	B-106
B-448	10047681	4/0	#2	115	B-106
B-449	10047682	250 kcmil	250 kcmil	200	B-106
B-450	10047683	250 kcmil	4/0	200	B-106
B-451	10047684	250 kcmil	3/0	200	B-106
B-452	10047685	250 kcmil	2/0	150	B-106
B-453	10047685	250 kcmil	1/0	150	B-106
B-454	10047685	250 kcmil	#1	115	B-106
B-455	10047685	250 kcmil	#2	115	B-106

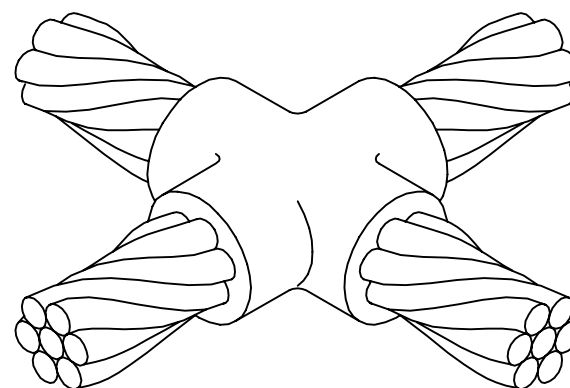

## NOTES:

- BCC-4 TYPE MOLDS ARE USED TO JOIN TWO HORIZONTAL CABLES AT RIGHT ANGLES. ONE CABLE IS CUT AND THE OTHER IS A THROUGH RUN.
- SIZE RANGE IS #6 THROUGH 500 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONNECTORS.
- FOR HEAVY DUTY MOLDS, MOLDS WITH WEAR PLATES OR MOLDS FOR COPPERWELD® CABLE, CONTACT BURNDY® PRODUCTS.
- REQUIRED TOOLS:  
HANDLE CLAMPS (SEE CHART ABOVE FOR CORRECT HANDLES), FOR HANDLES SEE DRAWING 10051615.  
B38-0309-00: FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B40-0319-01: MOLD CLEANER FOR CARTRIDGE SIZES #15 - #65  
B40-0319-03: MOLD CLEANER FOR CARTRIDGE SIZES #90 - #500  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH  
B38-0330-00: CABLE CLAMP

SEE TYPE BCC-11 FOUND ON DRAWING 10044342.

REV.	DATE	DESCRIPTION	ECO	BY	C'K'D.
B	05/16/14	LOGO UPDATE.	36146	GN	MB

TO ORDER BURNDY® PRODUCTS CALL  
UNITED STATES:  
1-800-346-4175 (LONDONDERRY, NH)  
CANADA:  
1-800-361-6975 (QUEBEC)  
1-800-387-6487 (ALL OTHER PROVINCES)  
FOR PRODUCT INFO: <http://www.burndy.com>

BURNDYweld™ HORIZONTAL TO HORIZONTAL CABLE CROSS

ITEM NO: N/A

CAT NO: BCC-4 SERIES

SCALE: N/A

DRAWN BY: P LAPONIUS 12/8/04

CHECKER: D SHIBILIA 1/3/05

DSN APPVL: D SHIBILIA 1/13/05

MFG APPVL: ---

QC APPVL: J BRODEUR 1/14/05

MKT APPVL: R ROBICHEAU 1/18/05

PROD FAM: ---

PROJECT #: ---

DOCUMENT TYPE: Sales

REL LEVEL: AutoCAD

DRAWING NO

10044341


SHEET 1 OF 2

REV

B

BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	CABLE		WELD METAL	HANDLE CLAMPS
		RUN	TAP		
B-456	10047689	300 kcmil	300 kcmil	250	B-106
B-457	10047690	300 kcmil	250 kcmil	250	B-106
B-458	10047691	300 kcmil	4/0	200	B-106
B-459	10047692	300 kcmil	3/0	200	B-106
B-460	10047693	300 kcmil	2/0	150	B-106
B-461	10047694	300 kcmil	1/0	150	B-106
B-462	10047695	300 kcmil	#1	115	B-106
B-463	10047696	300 kcmil	#2	115	B-106
B-464	10047697	350 kcmil	350 kcmil	250	B-106
B-465	10047698	350 kcmil	300 kcmil	250	B-106
B-466	10047699	350 kcmil	250 kcmil	250	B-106
B-467	10047700	350 kcmil	4/0	200	B-106
B-468	10047701	350 kcmil	3/0	200	B-106
B-469	10047702	350 kcmil	2/0	200	B-106
B-470	10047703	350 kcmil	1/0	200	B-106
B-471	10047704	350 kcmil	#1	150	B-106
B-472	10047705	350 kcmil	#2	150	B-106
B-483	10047706	500 kcmil	500 kcmil	500	B-107
B-485	10047707	500 kcmil	350 kcmil	2-200	B-107
B-486	10047708	500 kcmil	300 kcmil	2-200	B-107
B-487	10047709	500 kcmil	250 kcmil	2-150	B-107
B-488	10047710	500 kcmil	4/0	2-150	B-107
B-489	10047711	500 kcmil	3/0	2-150	B-107
B-490	10047712	500 kcmil	2/0	250	B-106
B-491	10047713	500 kcmil	1/0	250	B-106
B-492	10047714	500 kcmil	#1	200	B-106
B-493	10047715	500 kcmil	#2	200	B-106

REV.	DATE	DESCRIPTION	ECO	BY	C'K'D.
B	05/16/14	LOGO UPDATE.	36146	GN	MB

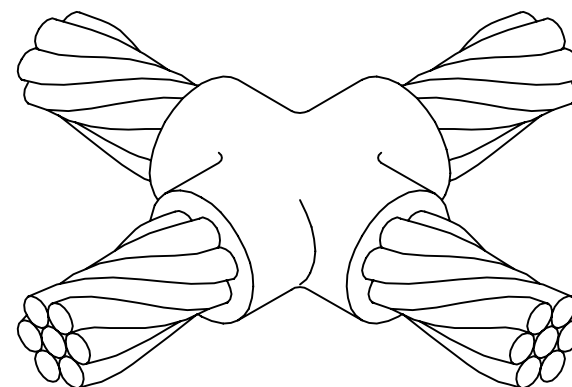

## NOTES:

- BCC-4 TYPE MOLDS ARE USED TO JOIN TWO HORIZONTAL CABLES AT RIGHT ANGLES. ONE CABLE IS CUT AND THE OTHER IS A THROUGH RUN.
- SIZE RANGE IS #6 THROUGH 500 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONNECTORS.
- FOR HEAVY DUTY MOLDS, MOLDS WITH WEAR PLATES OR MOLDS FOR COPPERWELD® CABLE, CONTACT BURNDY® PRODUCTS.
- REQUIRED TOOLS:  
HANDLE CLAMPS (SEE CHART ABOVE FOR CORRECT HANDLES), FOR HANDLES SEE DRAWING 10051615.  
B38-0309-00: FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B40-0319-01: MOLD CLEANER FOR CARTRIDGE SIZES #15 - #65  
B40-0319-03: MOLD CLEANER FOR CARTRIDGE SIZES #90 - #500  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH  
B38-0330-00: CABLE CLAMP

TO ORDER BURNDY® PRODUCTS CALL  
UNITED STATES:  
1-800-346-4175 (LONDONDERRY, NH)  
CANADA:  
1-800-361-6975 (QUEBEC)  
1-800-387-6487 (ALL OTHER PROVINCES)  
FOR PRODUCT INFO: <http://www.burndy.com>

BURNDYweld™ HORIZONTAL TO HORIZONTAL CABLE CROSS

ITEM NO: N/A

CAT NO: BCC-4 SERIES

SCALE: N/A

DRAWN BY: P LAPONIUS 12/8/04

CHECKER: D SHIBILIA 1/3/05

DSN APPVL: D SHIBILIA 1/13/05

MFG APPVL: ---

QC APPVL: J BRODEUR 1/14/05

MKT APPVL: R ROBICHEAU 1/18/05

PROD FAM: ---

PROJECT #: ---

DOCUMENT TYPE: Sales

REL LEVEL: AutoCAD

DRAWING NO

10044341

SHEET 2 OF 2

REV

B