


10051641

BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	BUS BAR SIZE	CABLE SIZE	WELD METAL	HANDLE CLAMPS
B-743*	10049488	1/8" X 1"	1/0	90	B-106
B-744*	10049489	1/8" X 1"	2/0	90	B-106
B-745*	10049490	1/8" X 1"	4/0	115	B-106
B-746*	10049491	1/8" X 2"	1/0	90	B-106
B-747*	10049492	1/8" X 2"	2/0	90	B-106
B-748*	10049493	1/8" X 2"	4/0	115	B-106
B-749*	10049494	1/8" X 2"	250 kcmil	115	B-106
B-750*	10049495	1/8" X 2"	300 kcmil	150	B-106
B-751*	10049496	1/8" X 2"	350 kcmil	150	B-106
B-752*	10049497	1/4" X 1"	1/0	115	B-106
B-753*	10049498	1/4" X 1"	2/0	115	B-106
B-754*	10049499	1/4" X 1"	4/0	150	B-106
B-755*	10049500	1/4" X 1"	250 kcmil	150	B-106
B-756*	10049501	1/4" X 1"	300 kcmil	200	B-106
B-757*	10049502	1/4" X 1"	350 kcmil	200	B-106
B-759*	10049503	1/4" X 1"	500 kcmil	250	B-106
B-760*	10049504	1/4" X 1-1/2"	1/0	115	B-106
B-761*	10049505	1/4" X 1-1/2"	2/0	115	B-106
B-762*	10049506	1/4" X 1-1/2"	4/0	150	B-106
B-763*	10049507	1/4" X 1-1/2"	250 kcmil	150	B-106
B-764*	10049508	1/4" X 1-1/2"	300 kcmil	200	B-106
B-765*	10049509	1/4" X 1-1/2"	350 kcmil	200	B-106
B-767*	10049510	1/4" X 1-1/2"	500 kcmil	250	B-106
B-768*	10049511	1/4" X 1-1/2"	750 kcmil	2-200	B-107
B-769*	10049512	1/4" X 2"	1/0	115	B-106
B-770*	10049513	1/4" X 2"	2/0	115	B-106
B-771*	10049514	1/4" X 2"	4/0	150	B-106
B-772*	10049515	1/4" X 2"	250 kcmil	150	B-106
B-773*	10049516	1/4" X 2"	300 kcmil	200	B-106
B-774*	10049517	1/4" X 2"	350 kcmil	200	B-106
B-776*	10049518	1/4" X 2"	500 kcmil	250	B-106
B-777*	10049519	1/4" X 2"	750 kcmil	2-200	B-107
B-778*	10049520	1/4" X 2"	1000 kcmil	500	B-107

REV.	DATE	DESCRIPTION	ECO	BY	C'K'D.
B	8/2/2013	LOGO CHANGE	32732	VS	MB

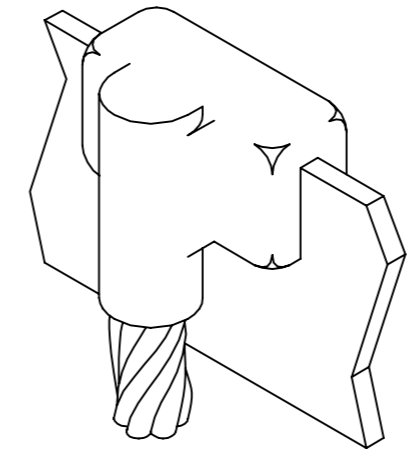

NOTES:

- TYPE BCB-7 MOLDS ARE USED TO CONNECT A VERTICAL CABLE TAP TO A HORIZONTAL COPPER BUS BAR ON ITS EDGE AND WHERE THERE SPACE RESTRICTIONS SUCH AS ANOTHER SURFACE 3/4" TO 5" FROM THE BUS BAR.
- SIZE RANGE IS 1/0 THROUGH 1000 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS. BUS SIZE RANGE IS FROM 1/8" X 1" THROUGH 1/2" X 3" AND WIDER.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONDUCTORS.
- FOR HEAVY DUTY MOLDS, ADD SUFFIX "H" TO THE MOLD NUMBER.
- REQUIRED TOOLS:  
HANDLE CLAMPS (SEE TABLE FOR CORRECT HANDLES). FOR HANDLES SEE DRAWING 10051615.  
\*SOLD COMPLETE WITH FRAME  
B38-0309-00: FLINT IGNITOR (INCLUDED) DRAWING 10051616.
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH

TO ORDER BURNDY® PRODUCTS CALL		BURNDYWeld™ VERTICAL DROP TAP TO HORIZONTAL BUS	
UNITED STATES: 1-800-346-4175 (LONDONDERRY, NH)		ITEM NO: N/A	
CANADA: 1-800-361-6975 (QUEBEC) 1-800-387-6487 (ALL OTHER PROVINCES)		CAT NO: BCB-7 SERIES	
FOR PRODUCT INFO: <a href="http://www.burndy.com">http://www.burndy.com</a>		SCALE: N/A	<b>BURNDY</b>
		DRAWN BY: D. BOISVERT 12/23/04	
		CHECKER: D. SHIBILIA 1/3/05	
		DSN APPVL: D. SHIBILIA 1/13/05	
		MFG APPVL: ---	DRAWING NO
		QC APPVL: J. BRODEUR 1/14/05	
		MKT APPVL: R. ROBICHEAU 1/18/05	REV
		PROD FAM: ---	B
		PROJECT #: ---	SIZE
		DOCUMENT TYPE: Sales	D
		REL LEVEL: AutoCAD	SHEET 1 OF 2