




DRAWING NO.  
**10051653**


BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	REBAR SIZE	CABLE SIZE	PACKING MATERIAL # 	WELD METAL	HANDLE CLAMPS
B-7588	10049867	#3	#6	B38-4060-00	45	B-106
B-7589	10049868		#4		45	B-106
B-7590	10049869		#2		65	B-106
B-7591	10049870		#1		65	B-106
B-7592	10049871		1/0		90	B-106
B-7593	10049872		2/0		90	B-106
B-7594	10049873		3/0		115	B-106
B-7595	10049874		4/0		115	B-106
B-7596	10049875	#4	#6	B38-4060-00	45	B-106
B-7597	10049876		#4		45	B-106
B-7598	10049877		#2		65	B-106
B-7599	10049878		#1		65	B-106
B-7600	10049879		1/0		90	B-106
B-7601	10049880		2/0		90	B-106
B-7602	10049881		3/0		115	B-106
B-7603	10049882		4/0		115	B-106
B-7604	10049883	#5	#6	B38-4060-00	90	B-106
B-7605	10049884		#4		90	B-106
B-7606	10049885		#2		90	B-106
B-7607	10049886		#1		90	B-106
B-7608	10049887		1/0		115	B-106
B-7609	10049888		2/0		115	B-106
B-7610	10049889		3/0		150	B-106
B-7611	10049890		4/0		150	B-106
B-7612	10049891	#6	#6	B38-4060-00	90	B-106
B-7613	10049892		#4		90	B-106
B-7614	10049893		#2		90	B-106
B-7615	10049894		#1		90	B-106
B-7616	10049895		1/0		115	B-106
B-7617	10049896		2/0		115	B-106
B-7618	10049897		3/0		150	B-106
B-7619	10049898		4/0		150	B-106

REV.	DATE	DESCRIPTION	ECO	BY	C*K'D.
B	12/03/12	DRAWING LOGO CHANGED.	29615	YM	MB

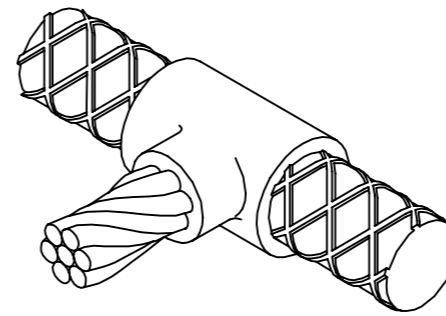

**NOTES:**

- TYPE BCRC-2 MOLDS ARE RECOMMENDED FOR RIGHT ANGLE, HORIZONTAL CONNECTIONS FOR SOLID OR CONCENTRIC STRANDED CONDUCTORS #6 THROUGH 4/0 JOINED TO REINFORCING BARS #3 THROUGH #6. THE HIGH COPPER CONTENT JOINT HAS A HIGHER CURRENT CARRYING CAPACITY THAN THE CONDUCTORS BEING AND IS IMPERVIOUS TO VIBRATION AND MOISTURE.
-  A PACKING PAD IS NECESSARY WHEN MAKING BURNDYWeld™ CONNECTIONS TO REBAR. PACKING MATERIAL B38-4060-00 IS A SPECIAL, PATENTED COPPER-WOOL PACKING, WITH ENOUGH IN EACH BAG TO DO BETWEEN 40 AND 50 CONNECTIONS. PACKING MATERIAL NUMBERS B38-4061-00, B38-4062-00 AND B38-4063-00 ARE A CERAMIC FIBER MATERIAL AND CAN BE USED FOR ONE CONNECTION ONLY. BE SURE TO SPECIFY PACKING MATERIAL NUMBER WHEN ORDERING MOLD AND WELD MATERIAL.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONDUCTORS.
- FOR HEAVY DUTY MOLDS, ADD SUFFIX "H" TO MOLD NUMBER.
- REQUIRED TOOLS:  
HANDLE CLAMPS (SEE CHART ABOVE FOR CORRECT HANDLES). FOR HANDLES SEE DRAWING 10051615.  
B38-0309-00: FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B40-0319-01: MOLD CLEANER FOR CARTRIDGE SIZES #15 - #65  
B40-0319-03: MOLD CLEANER FOR CARTRIDGE SIZES #90 - #500  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH  
B38-0304-00: FILE

<p>TO ORDER BURNDY® PRODUCTS CALL</p> <p>UNITED STATES: 1-800-346-4175 (LONDONDERRY, NH)</p> <p>CANADA: 1-800-361-6975 (QUEBEC) 1-800-387-6487 (ALL OTHER PROVINCES)</p> <p>FOR PRODUCT INFO: <a href="http://www.burndy.com">http://www.burndy.com</a></p>	BURNDYWeld™ HORIZONTAL CABLE TAP TO HORIZONTAL REBAR RUN		
	ITEM NO: (TABLE)		
	CAT NO: BCRC-2 SERIES (TABLE)		
	SCALE: NTS	DRAWN BY: D. BOISVERT 12/27/04	
	CHECKER: D. SHIBILIA 1/3/05	DSN APPVL: D. SHIBILIA 1/13/05	
MFG APPVL: ---	QC APPVL: J. BRODEUR 1/14/05		
MKT APPVL: R. ROBICHEAU 1/18/05			
PROD FAM: ---	PROJECT #: ---	DRAWING NO: 10051653	REV: B
DOCUMENT TYPE: Sales	REL LEVEL: AutoCAD	SIZE: D	SHEET 1 OF 1