
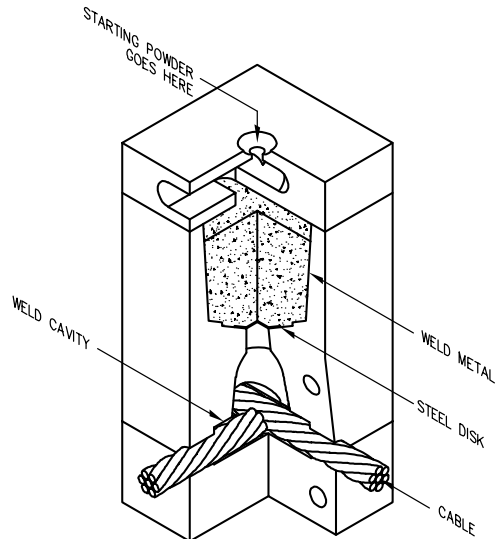



CABLE		MOLD #	PRICE KEY	WELD METAL	HANDLE CLAMPS
RUN	TAP				
#6	#6	M-5072	4	32	B-106
#4	#4	M-221	4	32	B-106
	1/0	M-8110	4	65	B-106
#2	#2	M-223	4	45	B-106
	#4	M-224	4	45	B-106
#1	#1	M-225	4	45	B-106
	#2	M-226	4	45	B-106
	#4	M-227	4	45	B-106
1/0	1/0	M-228	4	90	B-106
	#1	M-229	4	45	B-106
	#2	M-230	4	45	B-106
	#4	M-231	4	45	B-106
2/0	2/0	M-232	4	90	B-106
	1/0	M-233	4	90	B-106
	#1	M-234	4	45	B-106
	#2	M-235	4	45	B-106
3/0	#4	M-5475	4	45	B-106
	3/0	M-236	4	115	B-106
	2/0	M-237	4	90	B-106
	1/0	M-238	4	90	B-106
	#1	M-239	4	45	B-106
	#2	M-240	4	45	B-106
4/0	#4	M-5574	4	45	B-106
	500 MCM	M-5010	4	150	B-106
	4/0	M-241	4	150	B-106
	3/0	M-242	4	115	B-106
	2/0	M-243	4	90	B-106
	1/0	M-244	4	90	B-106
250 MCM	#1	M-245	4	90	B-106
	#2	M-246	4	90	B-106
	#4	M-5021	4	90	B-106
	250 MCM	M-247	4	150	B-106
	4/0	M-248	4	150	B-106
	3/0	M-249	4	150	B-106
300 MCM	2/0	M-250	4	90	B-106
	1/0	M-251	4	90	B-106
	#1	M-252	4	90	B-106
	#2	M-253	4	90	B-106
	300 MCM	M-254	4	200	B-106
	250 MCM	M-255	4	150	B-106
350 MCM	4/0	M-256	4	150	B-106
	3/0	M-257	4	150	B-106
	2/0	M-258	4	90	B-106
	1/0	M-259	4	90	B-106
	#1	M-260	4	90	B-106
	#2	M-261	4	90	B-106
240 SQMM	350 MCM	M-262	4	200	B-106
	300 MCM	M-263	4	200	B-106
	250 MCM	M-264	4	200	B-106
	4/0	M-265	4	150	B-106
	3/0	M-266	4	150	B-106
	2/0	M-267	4	90	B-106
500 MCM	1/0	M-268	4	90	B-106
	#1	M-269	4	90	B-106
	#2	M-270	4	90	B-106
	8X16 SQMM	M-11523	4	150	B-106
	500 MCM	M-280	4	2-150	B-106
	350 MCM	M-282	4	200	B-106
750 MCM	300 MCM	M-283	4	200	B-106
	250 MCM	M-284	4	200	B-106
	4/0	M-285	4	150	B-106
	2/0	M-286	4	90	B-106
	1/0	M-287	4	90	B-106
	#1	M-288	4	90	B-106
750 MCM	#2	M-289	4	90	B-106
	750 MCM	M-290	5	500	B-107
	500 MCM	M-291	5	2-200	B-107
	350 MCM	M-293	4	250	B-106
	300 MCM	M-294	4	200	B-106
	250 MCM	M-295	4	200	B-106
750 MCM	4/0	M-296	4	150	B-106
	2/0	M-297	4	150	B-106
	1/0	M-298	4	150	B-106

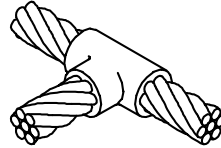


CC-2 TYPE MOLDS
HORIZONTAL CABLE TAP TO HORIZONTAL CABLE RUN

CC-2 TYPE MOLDS ARE USED TO JOIN HORIZONTAL CABLE TAP TO A HORIZONTAL RUN CABLE. SIZE RANGE IS #6 THROUGH 750 MCM SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.

- NOTES:
- FOR SIZES NOT LISTED, CONTACT THERMOWELD®.
 - MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONDUCTORS.
 - FOR HEAVY DUTY MOLDS, MOLDS WITH WEAR PLATES OR MOLDS FOR COPPERWELD® CABLE, CONTACT THERMOWELD®.
 - FOR EXPEDITED SERVICE, CONTACT THERMOWELD®.
 - REQUIRED TOOLS:
 HANDLE CLAMPS W/ FLINT IGNITOR (SEE CHART FOR CORRECT HANDLES)
 38-03-0900 ~ FLINT IGNITOR
 - OTHER RECOMMENDED ACCESSORIES:
 40-03-1901 ~ MOLD CLEANER FOR CARTRIDGE SIZES #15-#65
 40-03-1903 ~ MOLD CLEANER FOR CARTRIDGE SIZES #90-#500
 38-39-2200 ~ MOLD CLEANING BRUSH
 38-01-3500 ~ CABLE CLEANING BRUSH
 38-03-3000 ~ CABLE CLAMP

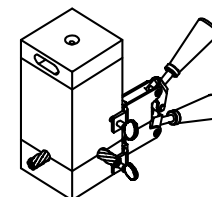

SHOWN WITH
HANDLE CLAMPS

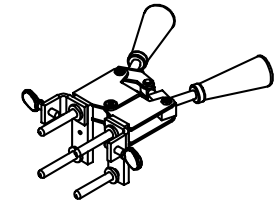

REF. B-106 / B-107
HANDLE CLAMPS

thermOweld®

REV	EC #	DESCRIPTION	DATE	INITIALS
B	211103014059	TEMPLATE UPDATED	11/04/21	BE
A	2532	UPDATED HANDLE CLAMPS	10/31/12	BAM

REVISION HISTORY

TO ORDER thermOweld® PRODUCTS CALL
 1-800-558-1373

CANADA:
 1-800-387-6487

FOR PRODUCT INFO:
<http://www.burndy.com>

SIGNATURES			
DRAWN BY	DATE	APPROVED BY	DATE
K. DAVE	8/29/08	<i>KDC</i>	3/8/13
MATERIAL			

BCC-2 TYPE MOLDS HORIZONTAL CABLE TAP TO HORIZONTAL CABLE RUN	
SIZE	DWG. NO.
C	CD-601
SCALE	SHEET 1 OF 1